

















Technical Information

Ceraphant T PTC31, PTP31, PTP35

Process pressure

Pressure switch for safe measurement and monitoring of absolute and gauge pressures



Application

Pressure switch for monitoring absolute and gauge pressures in gases, vapours, liquids and dust:

Ceraphant T PTC31

- with ceramic process isolating diaphragm;
 Ceraphant T PTP31
- with metallic process isolating diaphragm; Ceraphant T PTP35 $\,$
- for hygienic applications
- Finely graduated measuring ranges from vacuum to 400 bar (6000 psi)
- Versions for use in hygienic applications
- Electronic versions
 - one PNP switch output
 - two PNP switch outputs
 - PNP switch output with additional analog output 4...20 mA (active)



Your benefits

This compact pressure switch impresses with the latest in technology being used:

- Integrated switching electronics for decentral and economic process monitoring and control
- Quick and flexible process integration thanks to modular connections
- High reproducibility and long-term stability
- Function check and information on site thanks to LEDs and digital display
- Ceraphire[®] process isolating diaphragm: corrosionproof, abrasion-proof and extremely overload-resistant
- Excellent accuracy and briefest response time right to the smallest measuring range
- Operation and visualisation also with personal computer and ReadWin[®] 2000 or FieldCare®
- Upper part of housing can be rotated by 310°, therefore best readability of measured values in all orientations
- DESINA compliant
- 3A and EHEDG approved



Table of contents

Device selection
Measuring principle
Measuring system
6-,
Innut
Input
Measured variable4
Measuring range
Output
=
Output signal4
Range of adjustment
Switching capacity
Inductive load
Signal on alarm5
Load5
D (
Power supply6
Electrical connection
Supply voltage
Current consumption
Power supply failure
Performance characteristics8
Reference operating conditions 8
Switch output8
Analog output8
Influences of air pressure changes
Long-term drift
Long-term reliability
Thermal change
Operating conditions (installation)9
Installation instructions
0
Operating conditions (environment) 9
Operating conditions (environment)
Ambient temperature range9
Ambient temperature range
Ambient temperature range
Ambient temperature range9Storage temperature9Degree of protection9Shock resistance9Vibration resistance9
Ambient temperature range 9 Storage temperature 9 Degree of protection 9 Shock resistance 9 Vibration resistance 9 Electromagnetic
Ambient temperature range9Storage temperature9Degree of protection9Shock resistance9Vibration resistance9
Ambient temperature range 9 Storage temperature 9 Degree of protection 9 Shock resistance 9 Vibration resistance 9 Electromagnetic compatibility 9
Ambient temperature range 9 Storage temperature 9 Degree of protection 9 Shock resistance 9 Vibration resistance 9 Electromagnetic
Ambient temperature range 9 Storage temperature 9 Degree of protection 9 Shock resistance 9 Vibration resistance 9 Electromagnetic compatibility 9 Operating conditions (Process) 10
Ambient temperature range 9 Storage temperature 9 Degree of protection 9 Shock resistance 9 Vibration resistance 9 Electromagnetic compatibility 9 Operating conditions (Process) 10 Medium temperature range 10
Ambient temperature range 9 Storage temperature 9 Degree of protection 9 Shock resistance 9 Vibration resistance 9 Electromagnetic compatibility 9 Operating conditions (Process) 10 Medium temperature range 10 Limiting medium pressure range 10
Ambient temperature range 9 Storage temperature 9 Degree of protection 9 Shock resistance 9 Vibration resistance 9 Electromagnetic compatibility 9 Operating conditions (Process) 10 Medium temperature range 10
Ambient temperature range 9 Storage temperature 9 Degree of protection 9 Shock resistance 9 Vibration resistance 9 Electromagnetic compatibility 9 Operating conditions (Process) 10 Medium temperature range 10 Limiting medium pressure range 10 Pressure specifications 10
Ambient temperature range 9 Storage temperature 9 Degree of protection 9 Shock resistance 9 Vibration resistance 9 Electromagnetic compatibility 9 Operating conditions (Process) 10 Medium temperature range 10 Limiting medium pressure range 10 Pressure specifications 11 Mechanical construction 11
Ambient temperature range 9 Storage temperature 9 Degree of protection 9 Shock resistance 9 Vibration resistance 9 Electromagnetic compatibility 9 Operating conditions (Process) 10 Medium temperature range 10 Limiting medium pressure range 10 Pressure specifications 11 Mechanical construction 11 Design, dimensions 11
Ambient temperature range 9 Storage temperature 9 Degree of protection 9 Shock resistance 9 Vibration resistance 9 Electromagnetic compatibility 9 Operating conditions (Process) 10 Medium temperature range 10 Limiting medium pressure range 10 Pressure specifications 11 Mechanical construction 11
Ambient temperature range 9 Storage temperature 9 Degree of protection 9 Shock resistance 9 Vibration resistance 9 Electromagnetic compatibility 9 Operating conditions (Process) 10 Medium temperature range 10 Limiting medium pressure range 10 Pressure specifications 11 Mechanical construction 11 Design, dimensions 11
Ambient temperature range 9 Storage temperature 9 Degree of protection 9 Shock resistance 9 Vibration resistance 9 Electromagnetic compatibility 9 Operating conditions (Process) 10 Medium temperature range 10 Limiting medium pressure range 10 Pressure specifications 10 Mechanical construction 11 Design, dimensions 11 Process connection PTC31 Sensor module with ceramic process isolating diaphragm 12
Ambient temperature range 9 Storage temperature 9 Degree of protection 9 Shock resistance 9 Vibration resistance 9 Electromagnetic compatibility 9 Coperating conditions (Process) 10 Medium temperature range 10 Limiting medium pressure range 10 Pressure specifications 10 Mechanical construction 11 Design, dimensions 11 Process connection PTC31 Sensor module with ceramic process isolating diaphragm 12 Process connection PTP Sensor module with metallic process isolating
Ambient temperature range 9 Storage temperature 9 Degree of protection 9 Shock resistance 9 Vibration resistance 9 Electromagnetic compatibility 9 Operating conditions (Process) 10 Medium temperature range 10 Limiting medium pressure range 10 Pressure specifications 10 Mechanical construction 11 Design, dimensions 11 Process connection PTC31 Sensor module with ceramic process isolating diaphragm 12

Material (not wetted)	
Material (wetted)	. I7
Human interface	18
Operating elements	
On-site operation	
Operation with PC	
Comification and approvals	22
Certificates and approvals	
CE mark	
UL listing	
Suitability for hygenic processes	
Standards and guidelines	
Statitualus aliu guidelilies	. 22
Ordering Information	2 3
Ceraphant T PTC31	
Ceraphant T PTP31	
Ceraphant T PTP35	
Questionnaire on customer-	
specific configuration	. 28
A accessing	20
Accessories	25
– with sealing taper	20
Welding boss	
– with sealing surface	. 29
Thread adapter	
Clamp adapter	
Hygiene adapter	
Plug-in jack	. 30
Connecting cable	. 30
Configuration kit	
Power supply RNB130	. 3
Documentation	21
Field of Activities	
Field of Activities Technical Information	
Operating instructions	
~ ~	, ,

Function and system design

Device selection

Ceraphant T - product family	PTC31	PTP31	PTP35		
	P01-PTC31xxx-14-xx-xx-xx-001	P01-PTP31xxx-14-xx-xx-xx-001	P01-PTP35xxx-14-xx-xx-xx-001		
Measuring cell	With capacitive measuring cell and ceramic process isolating diaphragm (Ceraphire®)	With piezoresistive measuring cell and metallic process isolating diaphragm	With piezoresistive measuring cell and metallic process isolating diaphragm for hygienic applications		
Field of application	Measurement and monitoring of absolute and gauge pressures	Measurement and monitoring of absolute and gauge pressures	Measurement and monitoring of absolute and gauge pressures in hygienic processes		
Process connection	Thread - G ¼ female - G ¼A and G ½A - G ½A, hole 11.4 mm - M12x1,5 - 7/16-20 UNF - ¼ FNPT and ½ MNPT	Thread - G ¼ female - G ¼A and G ½A - G ½A, hole 11.4 mm - M12x1,5 - 7/16-20 UNF - ¼ FNPT and ½ MNPT - G ½A flush mounted	Hygiene - Clamp ½" - 2" - G 1A - Varivent F, N - DIN 11851 - APV inline - SMS 1½"		
Measuring range	0 to 0.1 bar (1.5 psi) to 0 to 40 bar (600 psi)	0 to 1 bar (15 psi) to 0 to 400 bar (6000 psi)	0 to 1 bar (15 psi) to 0 to 40 bar (600 psi)		
Process temperature	-40°C to +100°C (-40°F to +212°F)	-40°C to +100°C (-40°F to +212°F)	-40°C to +100°C (-40°F to +212°F) 135°C (275°F) max. 1 hour		

Measuring principle

Ceraphant T PTC31


The process pressure acts on the ceramic process isolating diaphragm and the pressure-dependent change in capacitance of the ceramic sensor is measured. A microprocessor evaluates the signal and switches the output or outputs the corresponding measured value.

The ceramic sensor is a dry sensor i.e. no fill fluid is needed for pressure transmission. This means that the sensor can fully support a vacuum. Extremely high durability, on a par with the material Alloy, is achieved through the use of the highly pure material Ceraphire[®] as a ceramic.

Ceraphant T PTP31 and PTP35

The process pressure acting upon the metallic process isolating diaphragm of the sensor is transmitted to a resistance bridge via a fluid. The change in the output voltage of the bridge is proportional to the pressure and can be measured directly.

Measuring system

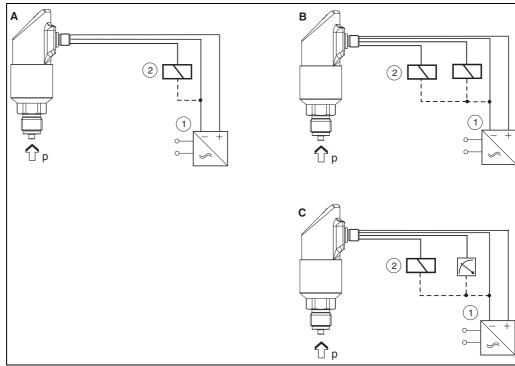

P01-PTx3xxxx-14-xx-xx-xx-001

- A: 1x PNP switch output
- B: 2x PNP switch output
- C: PNP switch output with additional analog output 4...20 mA (active).
- ① Transmitter power supply unit
- ② Load (e.g. programmable logic controller, process control system, relay)

Input

Measured variable

The measured variable for the pressure switch can be selected as either gauge pressure or absolute pressure.

Measuring range

Measuring ranges up to 400 bar (6000 psi), see "Ordering information" section.

Output

Output signal

DC voltage version: Positive voltage signal (rate depends on power supply voltage) at electronics switch output (PNP). Short-circuit proof version.

- 1x PNP switch output
- 2x PNP switch output
- PNP switch output with additional active analog output 4...20 mA.


 The analog output continuously represents the measuring range configured or specified by the sensor.

Range of adjustment ■ Switch output: Switch point (SP): 0.5...100 % in increments of 0.1 % (min. 1 mbar * (0.015 psi)) of the upper range limit Switch-back point (RSP): 0...99.5 % in increments of 0.1 % (min. 1 mbar * (0.015 psi)) of the upper range Min. distance between SP and RSP: 0.5% URL * measuring ranges with negative gauge pressure up to 4 bar (60 psi) in increments of min. 10 mbar (0.15 ■ Analog output (if available): Lower range value (LRV) and upper range value (URV) can be set anywhere within the sensor range (LRL -URL). Turn down of the analog output up to 4:1 of the upper range limit (URL). ■ Damping: can be set anywhere between 0...40 s in increments of 0.1 s • Factory setting (if no customer-specific settings have been ordered): Switch point SP 1: 45 %; Switch-back point RSP 1: 44.5 % Switch point SP 2: 55 %; Switch-back point RSP 2: 54.5 % Analog output: LRV 0 %; URV 100 % LRL = Lower Range Limit / URL = Upper Range Limit LRV = Lower Range Value / URV = Upper Range Value Switching capacity DC voltage version: ■ Switch status ON: $I_a \le 250$ mA, switch status OFF: $I_a \le 1$ mA ■ Switching cycles: >10,000,000 ■ Voltage drop PNP: ≤2 V • Overload resistance: Automatic load check of switching current; max. capacitance load: 14 μF at max. supply voltage (without resistive load) max. period length: 0.5 s; min. t_{on}: 40 μs Periodic disconnection from a protective circuit in event of overcurrent (f = 2 Hz) and indication of "Warning" Inductive load To prevent electrical interference, only operate an inductive load (relays, contactors, solenoid valves) when directly connected to a protective circuit (free-wheeling diode or capacitor). Signal on alarm Analog output \leq 3,6 mA / last current value / \geq 21,0 mA adjustable (if setting \geq 21.0 mA the output is \geq 21.5 mA) ■ Switch outputs: In safe state (switch normally open) Load Max. $(U_{Supply} -6.5 \text{ V}) / 0.22 \text{ A (analog output)}$

Power supply

Electrical connection


Connector and cable connection

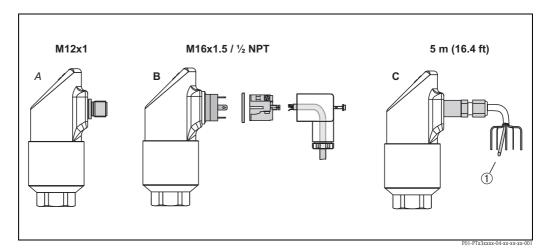


A: M12x1 connector; B: M16x1.5 or ⅓ NPT valve plug C: cable, 5 m (16.4 ft) long, 5-core ⊕ reference pressure supply

Device connection

■ DC voltage version with M12x1 connector

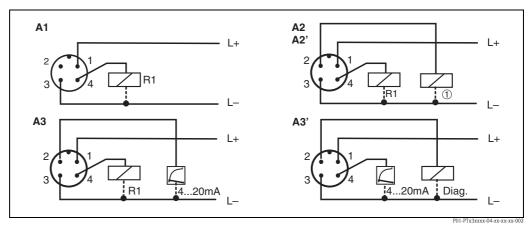


- A1: Ix PNP switch output
 A2: PNP switch outputs R1 and ① (R2)
 A2': PNP switch outputs R1 and ① (diagnosis/break contact with adjustment "DESINA")
 A3: PNP switch output with additional analog output
- A3': PNP switch output with additional analog output (PIN assignment with "DESINA" setting)
- DC voltage version with M16x1.5 or $\frac{1}{2}$ NPT valve plug

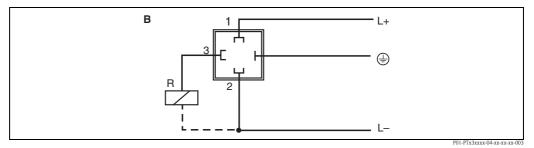

B: 1x PNP switch output

■ DC voltage version with cable

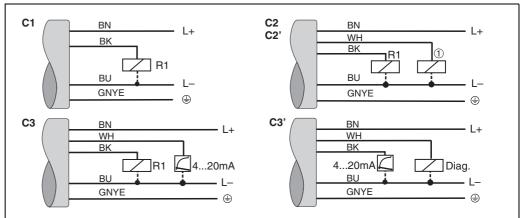

- C1: 1x PNP switch output C2: 2x PNP switch output
- C2': PNP switch outputs R1 and ① (diagnosis/break contact with adjustment "DESINA")
- C3: PNP switch output with additional analog output
- C3': PNP switch output with additional analog output (assignment with "DESINA" setting)

Cable specification: all three connection versions 5-core; 4 x 0.2 mm² (AWG25), PE 0.75 mm² (AWG18)

- Core colours: BN = brown, BK = black, WH = white, BU = blue, GNYE = green/yellow

Supply voltage

■ DC voltage version 12...30 V DC

Current consumption

Without load < 60 mA, with reverse polarity protection

Power supply failure

- Behaviour in case of overvoltage (>30 V) The device works continuously without any damage up to 34 V DC. The specific properties are no longer guaranteed if the supply voltage is exceeded. No damage is caused to the device in case of a short-term overvoltage up to 1 kV (as per EN 6100-4-5)
- Behaviour in case of undervoltage If the supply voltage drops below the minimum value, the device switches off (status as if not supplied with power = switch open).

Performance characteristics

The percentage information in the "Performance characteristics" section refer to the upper range limit (URL).

Reference operating conditions	To DIN IEC 60770 or DIN IEC 61003 $T = 25 \text{ C}$ (77 °F), relative humidity 45 to 75 %, ambient air pressure 860 to 1060 hPa
Switch output	 ■ Accuracy: deviation <0.5 % ■ Non-repeatability: <0.2 % ■ Response time: ≤20 ms
Analog output	 Maximum measured error: Non-linearity + hysteresis + non-repeatability: ≤0.5 % (as per limit point method) Non-linearity: ≤0.2 % (as per limit point method) Rise time T₉₀: ≤200 ms Settling time T₉₉: ≤400 ms
Influences of air pressure changes	In the case of air pressure changes the following additional measuring errors might occur: 400 bar (6000 psi): max. $0.0275~\%$ 100 bar (1500 psi): max. $0.1~\%$
Long-term drift	≤0.15 % per year
Long-term reliability	Mean time between failure (MTBF) > 100 years (calculated according to "British Telecom Handbook of Reliability Data No. 5)
Thermal change	≤ ± 1.5 % (-20 to +45°C (-4 to +113°F)) ≤ ± 2.0 % (-40 to +85°C (-40 to +185°F) ≤ ± 2.5 % (-40 to +100°C (-40 to +212°F))

Operating conditions (installation)

Installation instructions

- Any orientation
- Any position-dependent zero shift can be corrected. Offset: ±20 % URL
- Housing can be rotated up to 310 °

Oxygen applications

Oxygen and other gases can react explosively to oils, grease and plastics, such that, among other things, the following precautions must be taken:

- All components of the system, such as measuring devices, must be cleaned in accordance with BAM requirements (DIN 19247). (BAM = Federal Institute for Materials Research and Testing).
- Depending on the materials used, a certain maximum temperature and a maximum pressure must not be exceeded in oxygen applications. The maximum temperature T_{max} for oxygen applications is 60°C (140°F).

The devices suitable for gaseous oxygen applications are listed in the following table, indicated by p_{max} .

Order code for devices cleaned for oxygen applications	p _{max} for oxygen applications
PTC31 $-$ * * * * * * * 6 *, for devices with sensors, nominal value < 10 bar (150 psi)	Overpressure limit (OPL) of sensor ¹⁾
PTC31 – * * * * * * * 6 *, for devices with sensors, nominal value \geq 10 bar (150 psi)	30 bar (450 psi)

 \rightarrow See Page 23 ff "Ordering information", feature 80 "Sensor seal".

Operating conditions (environment)

Ambient temperature range	-20 to $+70$ °C (-4 to $+158$ °F), briefly up to $+100$ °C (212 °F) Extended temperature application range (-40 °C to $+85$ °C (-40 °F to $+185$ °F)) with restrictions in optical properties such as display speed and contrast.			
Storage temperature	-40 to +85°C (-40 to 185°F)			
Degree of protection	■ M12x1 connector Gauge pressure sensors IP 65; Absolute pressure sensors: IP 66			
	■ M16x1.5 or ½ NPT valve plug IP 65			
	■ Cable: IP 66			
	For applications where the device is installed outdoor or cleaned from outside we recommend the use of a protection cap.			
Shock resistance	50 g to DIN IEC 68-2-27 (11 ms)			
Vibration resistance	20 g to DIN IEC 68-2-6 (10-2000Hz)			
Electromagnetic compatibility	 Interference emission as per EN 61326, class B electrical equipment Interference immunity as per EN 61326, appendix A (industrial use) 			

Operating conditions (Process)

Medium temperature range

- PTC31: -20 °C...+100 °C (-4 °F to +212 °F)
- PTP31: -40°C...+100°C (-40°F to +212°F)
- PTP35: -40°C...+100°C (-40°F to +212°F), +135°C (+275°F) for max. 1 hour

Please also note the temperature limits of the seal in the following table.

Seal	Temperature limits
FKM	-20+100 °C (-4 °F to +212 °F)
EPDM, FDA-Nummer 21 CFR 177.2600, Class II 3A Sanitary Standard 18, USP Class VI	-20+100 °C (-4 °F to +212 °F)
FKM for O2 usage (70C3 CO2 - 70 - 0041V)	-1060 °C (+14 °F to 140 °F)

With applications involving saturated steam, a Ceraphant T with a metallic process isolating diaphragm must be used, or a siphon for temperature isolation should be provided during installation.

Extreme jumps in temperature can result in temporary errors. Temperature compensation takes effect after several minutes. Internal temperature compensation is faster the smaler the temperature jump and the longer the time interval

Limiting medium pressure range

- For overload resistance see "Ordering information" section
- Vacuum resistance

For ceramic sensor with nominal value >100 mbar (1.5 psi): 0 mbar_{abs} (0 psi)

For ceramic sensor 100 mbar (1.5 psi): 700 mbar_{abs} (10.5 psi)

For metallic sensor: $10 \text{ mbar}_{abs} (0.15 \text{ psi})$ (The vacuum resistance applies for the measuring cell under reference operating conditions.)

Pressure specifications

The maximum pressure for the measuring device is dependent on the weakest element with regard to pressure, see the following sections "Ordering information: Measuring range" and "Mechanical construction"

The MWP (maximum working pressure) is specified on the nameplate. This value refers to a reference temperature of +20 °C (-68°F) and may be applied to the device for an unlimited time.

The test pressure (Over Pressure Limit OPL) corresponds to 1.5 times the MWP and may be applied for a limited time only in order to avoid lasting damage.


Avoid steam hammering! Steam hammering can cause zero point drift.

Recommendation: Residue (such as condensation or drops of water) can remain at the process isolating diaphragm after CIP cleaning and lead to local steam hammering if immediately steam is introduced. In practice, drying the process isolating diaphragm (e.g. by blowing off excess moisture) has proven to be a successful way of avoiding steam hammering.

Mechanical construction

Design, dimensions

Dimensions

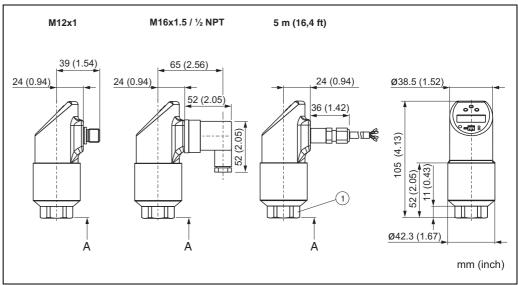


M12x1 connector as per IEC 60947-5-2

M16x1.5 or 1/2 NPT valve plug as per DIN 43650A/ISO 4400

Cable 5 m (16 ft) long, cable outer diameter 7.7 mm (0.3 in); cores 4 x 0.2 mm² (AWG 24), PE 0.75 mm² (AWG 18) reference pressure hose with outer diameter 2.5 mm (0.1 in)

① Across flats AF 27 mm(for 400 bar (6000 psi) sensor AF 32 mm) A = height dimension of process connections - see next diagrams

Process connection

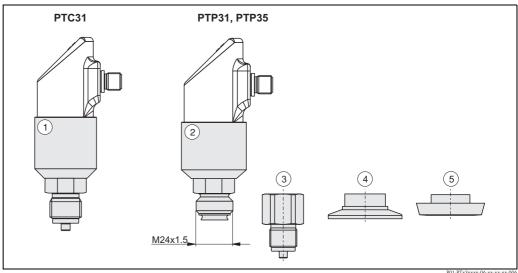


PTC31: sensor module ① with process connection.

PTP31/35: sensor module ② with M24x1.5 adapter thread for adapters with process connection.

Adapter (mounted onto sensor module at the factory, 400 bar (6000 psi) thread adapter welded onto sensor module)

- Adapter with thread connection
 Adapter with clamp connection (except ½" clamp)
 Adapter with hygienic connection (except G IA)

Process connection PTC31 Sensor module with ceramic process isolating diaphragm

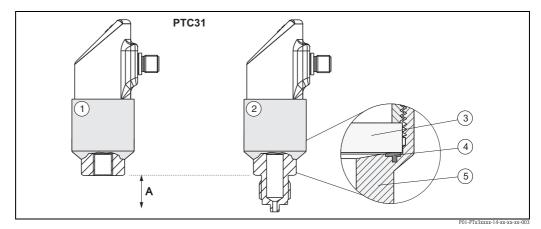


PTC31; sensor module with process connection

- ① with internal thread
- 2 with external thread

"Seal" detail: 3 Ceraphire ceramic sensor, 4 moulded seal, in contact with process, 5 sensor module

Dimension A: see the following dimension drawings (dimension with *)

Thread connections

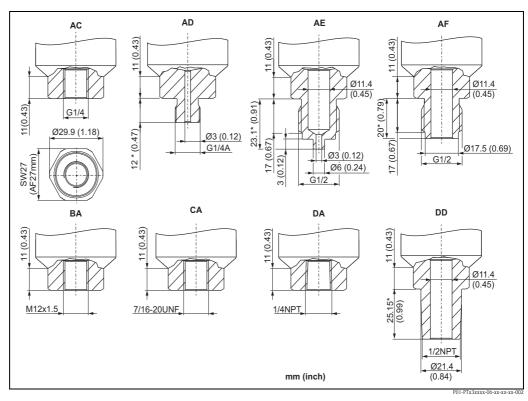


Process connection versions (see also "Ordering information" section) AC: thread ISO 288, G¼ (female) AD: thread ISO 288, G¼A

AE: thread ISO 288, G1/2A

AE. thread ISO 288, G½A, bore 11 mm (0.43 in)
BA: Thread DIN 13, M12x1.5
CA: thread 7/16-20 UNF (SAE)
DA: thread ANSI ¼ FNPT

DD: thread ANSI 1/2 MNPT


Process connection PTP Sensor module with metallic process isolating diaphragm

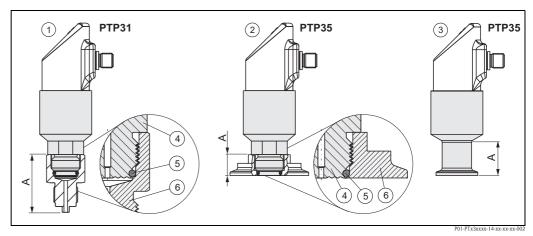

- ① Sensor module with adapter thread for adapters with thread connection
- ② Sensor module with adapter thread for adapters with clamp or hygiene connection
- 3 Sensor module with clamp or hygiene connection (only versions DA, BA, BB)

Dimension A: see the following dimension drawing (dimension with *). For 400 bar (6000 psi) sensor see also Page 12.

Process connection PTP31 Thread connections

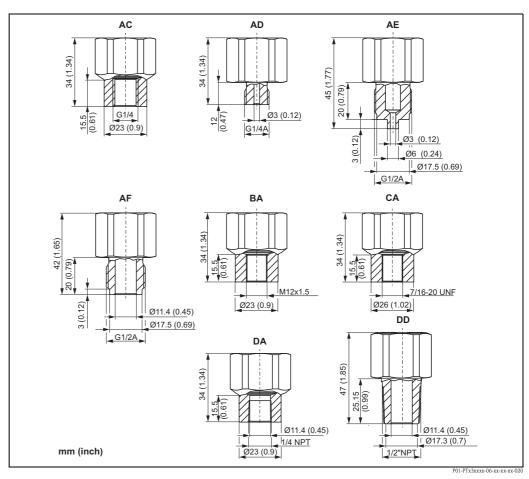

Process connection versions: sensor module with adapter (see also "Ordering information" section) AC: thread ISO 228, $G^{\prime\prime}$ 4 (female) AD: thread ISO 228, $G^{\prime\prime}$ 4A

AE: thread ISO 228, G¹/₂A AF: thread ISO 228, G¹/₂A, bore 11 mm (0.43 in)


BA: Thread DIN 13, M12x1.5

CA: thread 7/16-20 UNF (SAE) DA: thread ANSI 1/4 FNPT

DD: thread ANSI 1/2 MNPT

[&]quot;Seal" detail: ④ sensor module, ⑤ Standard O-ring, in contact with process, ⑥ adapter


Process connection PTP31 Flush-mounted nozzle

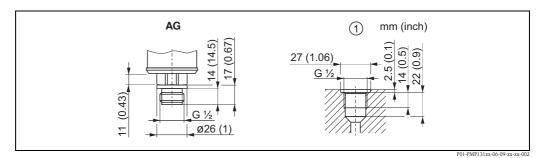

Process connection PTP31; Version AG. Diameter of the process isolation diaphragm 17.2 mm (0.68 in).

AG: Thread ISO 228 G ½, seal DIN 3852 flush-mounted, Weld-in adapter 52002643 \oplus : Dimensions for tapped hole G ½ as per DIN 3852-11 form X

Process connection PTP35 Hygiene connections

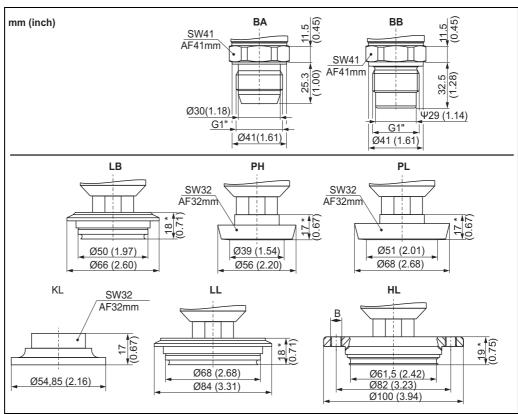


Process connection versions. Diameter of the process isolation diaphragm 17.2 mm (0.68 in). BA: thread ISO 228 G1A, metallic taper seal BB: thread ISO 228 G1A (EHEDG, 3A), O-ring seat seal

Process connection versions (sensor module with adapter). Diameter of the process isolation diaphragm 17.2 mm (0.68 in). LB: Varivent F pipe DN 25-32, PN 40 (EHEDG, 3A)
LL: Varivent N pipe DN 40-162, PN 40 (EHEDG, 3A)
PH: DIN 11851, DN 40, PN 40 (including slotted nut) (EHEDG, 3A)
PL: DIN 11851, DN 50, PN 25 (including slotted nut) (EHEDG, 3A)
HL: APV inline, DN 50, PN 40, (B = bores 6 x Ø8.6 + 2 x M8 thread) (EHEDG, 3A)

KL: SMS 11/2 PN 25, 316L (EHEDG, 3A)

See also "Ordering information" section

Process connection PTP35 Clamp connections

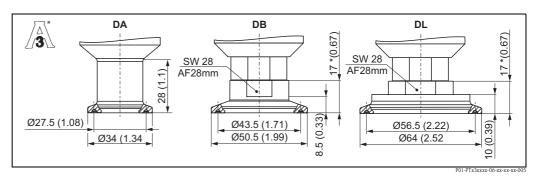

Process connection version Diameter of the process isolation diaphragm 17.2 mm (0.68 in). DA: Clamp ISO 2852 DN 22 (34") or DN 20 (DIN 32676) (EHEDG, 3A)

Process connection versions (sensor module with adapter). Diameter of the process isolation diaphragm 17.2 mm (0.68 in). DB: Tri-Clamp ISO 2852 DN 25...DN 38 (1"...1½") or DN 25...DN 40 (DIN 32676) (EHEDG, 3A) DL: Tri-Clamp ISO 2852 DN 40...DN51 (2") or DN 50 (DIN 32676) (EHEDG, 3A)

See also "Ordering information" section

PTP31 with 400 bar (6000 psi) sensor


- Across flats on sensor module AF 32 mm
- Sensor module welded to thread adapter
- For $\frac{1}{4}$ NPT thread connections, M12x1.5, $\frac{7}{16}$ -20UNF: dimension A 5 mm (0.2 in) longer For $\frac{1}{2}$ NPT thread connections, G $\frac{1}{2}$ A: dimension A 1 mm (0.04 in) longer

Weight

- PTC31: approx. 0.32 kg (0.71 lbs)
- PTP31: approx. 0.37 kg (0.82 lbs)
- PTP35: approx. 0.58 kg (1.28 lbs) with clamp process connection 1...1½"

Material (not wetted)

Housing

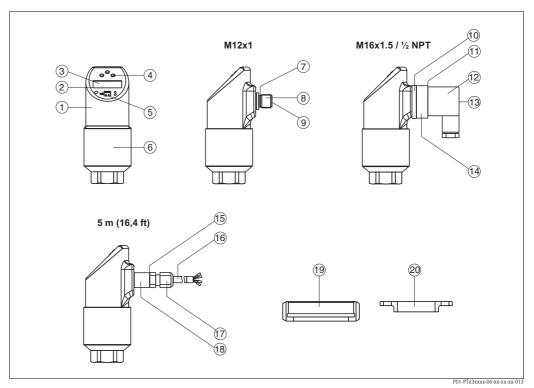

Front view, left-hand side view


Item number	Component part	Material
1	Housing F25	AISI 316 L (1.4404) with electropolished surface $R_a \le 0.8 \mu m$ (31,5 μin)
2	Seal between display and housing	Closed-cell acrylate adhesive
3	Dispay	PC-FR LEXAN 943A
4	Keys	PC-FR LEXAN
5	CDI cover	TPE SANTOPRENE 151-60
6	Sensor jack	1.4435
7	Oring	FKM
8	M-12 jack	316L (1.4404/1.4435)
9	Inner jack	PA; contacts CuZn nickel-plated
10	Valve jack	316L (1.4404/1.4435)
11	Seal jack	NBR
12	ISO plug	PA
13	Screw	V2A
14	Jack	PBT-FR
15	O ring	EPDM
16	Cable	PUR/UL 94 V0
17	Cable gland	PA
18	M16 jack	316L (1.4404/1.4435)
19	Coupling nut SMS 11861	1.4307
20	Coupling nut DRD	1.4301

Filling oil

Filling oil for PTP31 and PTP35: synthetic oil, FDA number 21 CFR 178.3570

Devices with M12 plug

PIN assignment for M12 connector

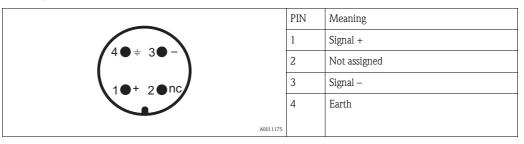

Endress+Hauser offers the following accessories for devices with an M12 plug:

Plug-in jack M12x1, straight

- Material: body PA; slotted nut CuZn, nickel-plated
- Degree of protection (fully locked): IP67
- Order number: 52006263

Plug-in jack M12x1, elbowed

- Material: body PBT/PA; slotted nut GD-Zn, nickel-plated
- Degree of protection (fully locked): IP67
- Order number: 71114212

Cable 4x0.34 mm² (20 AWG) with M12 socket, elbowed, screw plug, length 5 m (16 ft)

- Material: body PUR; slotted nut CuSn/Ni; cable PVC
- Degree of protection (fully locked): IP67
- Order number: 52010285

Material (wetted)

Note!

TSE Certificate of Suitability

The following applies to all process wetted device components:

- They do not contain any materials derived from animals.
- No auxiliaries or operating materials derived from animals are used in production or processing.

Process connection

- Process connection: AISI 316L (1.4435) Surfaces in contact with the process for PTP35 $R_a \le 0.8 \mu m$ (31,5 μin)
- "Clamp connections" and "Hygienic connections" (see also "Ordering information" section): AISI 316L (DIN/EN material number 1.4435)

Process isolating diaphragm

- PTC31: Ceraphire[®] (99,9 % Al₂O₃). The US Food & Drug Administration (FDA) has no objections to the use
 of ceramics made from aluminum oxide as a surface material in contact with foodstuffs. This declaration is
 based on the FDA certificates of our ceramic suppliers.
- PTP31/35: AISI 316L (1.4435)


Seals

- FKM
- EPDM: FDA number 21 CFR 177.2600, Class II 3A Sanitary Standard 18, USP Class VI,
- FKM for O₂ applications (70C3 CO2-70-0041V)

Human interface

Operating elements

Position and meaning of display and operating elements.

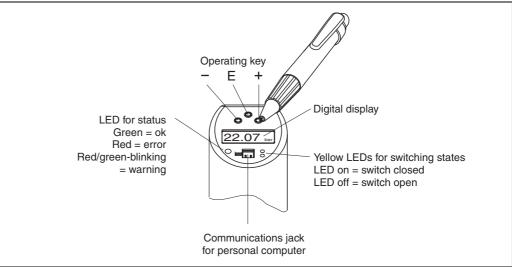

The background illumination of the digital display indicates the status of the device: white = ok; red = error

P01-PTx3xxxx-19-xx-xx-en-003

On-site operation

Menu-guided operation using operating keys.

Function group	Operating options					
BASE	Selection of unit: bar, psi, kPa/MPa					
(basic functions)	Offset: ±20 % URL					
	Damping display value, output signal: anywhere between 040 s (in increments of 0.1 s)					
	Display: — Display of measured value or configured switch point — Rotation of display by 180° — Switching off display					
	Behaviour according to DESINA: The PIN assignment of the M12 connector is in accordance with the guidelines of DESINA (DESINA = distributed and standardised installation technology for machine tools and manufacturing systems)					
OUT (Configuration of 1st output)	Output function: - Hysteresis function or window function - NC contact or NO contact (see next diagram) - Analog output 420 mA					
	Switch point: — Input value — Acceptance of applied value Switch point anywhere between 0.5100 % URL (in increments of 0.1 %, min. 0.001 bar (0.015 psi))					
	Switch-back point: — Input value — Acceptance of applied value Switch-back point anywhere between 099.5 % URL (in increments of 0.1 %, min. 0.001 bar (0.015 psi))					
	Switch output delay: anywhere between 099 s (in increments of 0.1 s)					

Function group	Operating options					
OUT 2 (Configuration of 2nd output, only for corresponding electronics version)	Output function: - Hysteresis function or window function - NC contact or NO contact (see next diagram) - Analog output 420 mA					
	Switch point 2: — Input value — Acceptance of applied value Switch point anywhere between 0.5100 % URL (in increments of 0.1 %, min. 0.001 bar (0.015 psi))					
	Switch-back point 2: — Input value — Acceptance of applied value Switch-back value anywhere between 099.5 % URL (in increments of 0.1 %, min. 0.001 bar (0.015 psi))					
	Switch output delay: anywhere between 099 s (in increments of 0.1 s)					
4-20 (configuration of analog output, only for corresponding electronic version)	Lower range value (LRV) and upper range value (URV) of analog output: — Input value — Acceptance of applied value Anywhere within sensor range (in increments of 0.1 %); turn down up to 4 : 1					
electronic version)	Setting of error current: choice of \leq 3.6 mA / \geq 21.0 mA / last current value					
SERV	Resetting of all settings to factory settings					
(service functions)	Static Revision Counter (configuration counter; increases by one with every change in configuration)					
	Locking by means of freely selectable code					
	Display of last error to occur					
	Simulation of switch output and analog output					
	Display of max. measured pressure value					
	Display of min. measured pressure value					
Note	Measuring ranges with negative gauge pressure up to 4 bar (60 psi) in increments of min. 0.01 mbar (0.15 psi)					

Functions of switch output


■ Hysteresis function

The hysteresis function enables two-point control via a hysteresis. Depending on the pressure p, the hysteresis can be set via the switch point SP and the switch-back point RSP.

■ Window function

The window function enables the monitoring of a process pressure range. The hysteresis of the switch points SP and RSP is less than 0.1 % URL. Under rough EMC conditions quick switching is possible if the measured value is near to SP or RSP. Setting a damping of 0.1 s will avoid this effect.

■ NO contact or NC contact This switch function is freely selectable.

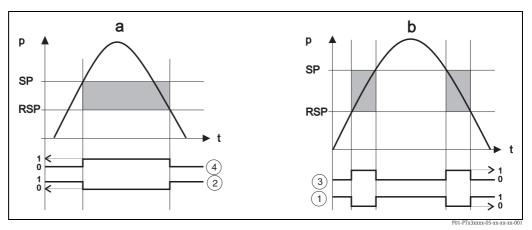

- a Hysteresis function


- b Window function

 ① Window NC contact switch status
 ② Hysteresis NC contact switch status
- ③ Window NO contact switch status
- 4 Hysteresis NO contact switch status

SP Switch point RSP Switch-back point

Operation with PC

The device can be configured with the configuration software ReadWin® 2000 or FieldCare®. For the connection between the USB port of the computer and the device a configuration kit (e. g. TXU10 or FXA291) is necessary.

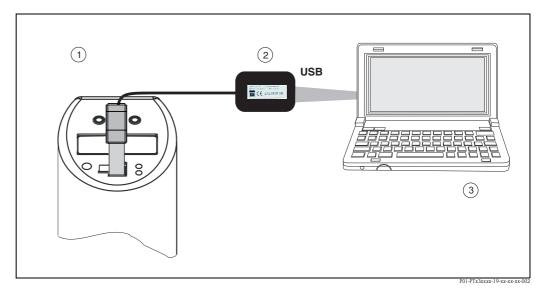

- ① Ceraphant T with communication jack
- © Configuration kit TXU10-AA or FXA291(USB interface)

 ® Personal computer with ReadWin® 2000 or FieldCare® configuration software

In addition to the operating options listed in the previous "On-site operation" section, the ReadWin® 2000 or FieldCare® configuration software provides further information on the Ceraphant T (reset only via on-side display):

Function group	Description				
SERVICE	Number of switch changes				
	Device status/error				
INFO	Tag number				
	Order code				
	Device serial number				
	Sensor serial number				
	Electronics serial number				
	Device release (change status)				
	Hardware version				
	Software version				

Comprehensive information on the ReadWin® 2000 configuration software may be found in the Operating Instructions BA00137R/09/en.

The configuration kit TXU10-AA is available as an accessory (see chapter Assessories). For the order of the configuration kit FXA291 or software FieldCare please ask your E+H sales organisation.

Certificates and approvals

CE markThe device meets the legal requirements of the EC directives. Endress+Hauser confirms that the device has been successfully tested by applying the CE mark.

UL listing The device was examined by Underwriters Laboratories Inc. USA (UL) in accordance with the standards UL 61010B-1 and CSA C22.2 No. 1010.1-92 and listed under the number E225237 UL for Canada and the USA.

Pressure Equipment Directive (PED)

This measuring device corresponds to Article 3 (3) of the EC Directive 97/23/EC (Pressure Equipment Directive) and has been designed and manufactured according to good engineering practice.

Suitability for hygenic processes

All materials in contact with foodstuffs comply with framework Regulation (EC) 1935/2004. The device is available with hygienic process connections (overview: see order code).

Caution!

Risk of contamination if incorrect seals and parts are used!

- To avoid the risk of contamination, when installing the device comply with the design principles of EHEDG, Guideline 37 "Hygienic Design and Application of Sensors" and Guideline 16 "Hygienic Pipe Couplings".
- Suitable assemblies and seals must be used to ensure hygienic design in accordance with 3-A SSI and EHEDG specifications.
- The leak-proof connections can be cleaned with the cleaning methods typical of this industry (CIP and SIP). Attention must be paid to the pressure and temperature specifications of the sensor and process connections for CIP and SIP processes (clean in place/sterilize in place).





Standards and guidelines

DIN EN 60770 (IEC 60770):

Transmitters for use in industrial-process control systems

Part 1: Methods for performance evaluation.

DIN EN 61003-1, publication date:1993-12

Industrial-process control systems - Instruments with analog inputs and two- or multi-state outputs - Part 1: Methods of evaluating the performance.

DIN 16086

Electrical pressure measuring instruments; pressure sensors, pressure transmitters, pressure measuring instruments;

concepts, specifications on data sheets

IEC 60529

Degrees of protection provided by enclosures (IP code).

EN 61326

Electrical equipment for measurement, control and laboratory use - EMC requirements.

IEC 61010

Safety requirements for electrical equipment for measurement, control and laboratory use.

EN 61000-4-5

Electromagnetic compatibility (EMC) -

Part 4: Testing and measurement techniques; Section 5: Surge immunity test

Ordering Information

Ceraphant T PTC31

This overview does not mark options which are mutually exclusive.

10	Certificate									
10	A For non-hazardous areas									
	71									
20		Electrical connection								
		1	M 12	x1 conr	nector: IP 6	5; with sensors for gauge	pressure and absolute pressu	ıre: IP (56	
		2	M16x1.5 valve plug, ISO 4400: IP 65							
		3	½NPT valve plug, ISO 4400: IP 65							
		4 5 m (16.4 ft) cable: IP 66								
30			Elect	ronic	s, output	signal				
					-	switch, 3-wire				
			B 12	230V	DC, 2 PN	P switch, 4-wire				
			C 12	230 V	DC, PNP	switch + 420mA, 4-wire	2			
40				ionles						
40				isplay		mlare				
	ļ		1	VVILLI	digital dis	piay				
50				Sen	sor					
				Gaug	e pressure		Max. working pressure	MWP	Overload OPL	
				1C		/ 010 kPa	2.7 bar		4 bar	
				1F		r / 040 kPa	5.3 bar		8 bar	
				1 H		/ 0100 kPa	6.7 bar		10 bar	
				1M		/ 0400 kPa	16.7 bar		25 bar	
				1P		/ 01000 kPa	26.7 bar		40 bar	
				1S	040 bai	:/ 04000 kPa	40 bar		60 bar	
				Nega	tive gauge	pressure	Max. working pressure	MWP	Overload OPL	
				5C	-0.10.1	bar / -1010 kPa	2.7 bar		4 bar	
				5F	-0.40.4	bar / -4040 kPa	5.3 bar		8 bar	
				5H	-11 bar	/ -100100 kPa	6.7 bar		10 bar	
				5M	-14 bar	/ -100400 kPa	16.7 bar		25 bar	
				5P	-110 ba	r / -1001000 kPa	26.7 bar		40 bar	
	1			Abso	lute pressu	re	Max. working pressure	MWP	Overload OPL	
				2F		r / 040 kPa	5.3 bar		8 bar	
				2H	01 bar	/ 0100 kPa	6.7 bar		10 bar	
				2M	04 bar	/ 0400 kPa	16.7 bar		25 bar	
				2P	010 bar	/ 01000 kPa	26.7 bar		40 bar	
				2S	040 bar	/ 04000 kPa	40 bar		60 bar	
60					Configu	ration and unit				
						r range: bar		Calib	ration in sensor range	
						r range: kPa/MPa			ration in sensor range	
						r range: psi			ration in sensor range	
					S Switc	h output 1, see additional	specification	Calib	ration in sensor range	
					T Switc	h output 1 + 2, see additio	nal specification	Calib	ration in sensor range	
					U Switc	h and analog output, see a	a and analog output, see additional specification Calibration in sensor range			
						h output 1, switch output	, 1	Calib	ration in sensor range	
					W Analo	Analog output, switch output DESINA, see add. spec. Calibration in sensor range				
70	Process connection, material									
	AC Thread ISO 288, G¼ (female), 316L									
					AD					
					AE	Thread ISO 228, G1/2A, 3	16L			
					AF	Thread ISO 228, G½A, be	ore 11.4 mm, 316L			
					BA	Thread DIN 13, M 12x1.	5, 316L			
					CA	Thread 7/16-20 UNF (SA	**			
					DA	Thread ANSI ¼ FNPT, 31				
	- 1				DD	Thread ANSI ½ MNPT, 3	IOL			
80						Sensor seal (in conta	act with process)			
						1 FKM sensor seal				
						4 EPDM sensor seal				
						6 FKM sensor seal, clea	aned for O ₂ service			
90						Additional equip	ment			
,,										
	A Without additional equipment B Final inspection report									
						-	ection), inspection certifica	te to EN	N 10204	

90					Additional equipment					
					D	D Final inspection report + 3.1 (process connection), inspect. certificate to EN 10204				
995					Marking:					
						1	Tagging (TAG), see additional spec.			
PTC31							order code			

Ceraphant T PTP31

This overview does not mark options which are mutually exclusive.

10	C	ertii	ficat	e								
	A			-hazardoı	ıs areas							
20		El	ectri	ical con	nection							
		1				65; with sensors for gauge pressure and absolute pressure: IP 66						
		2				O 4400: IP 65						
		3				4400: IP 65						
		4	5 III	1 (10.4 π)	cable: IP	00						
30					s, outpu	~						
			A B		,	switch, 3-wire P switch, 4-wire						
					,	'switch + 420mA, 4	-wire					
40		! 		_		,						
40				Display 1 With	digital di	enlav						
=0						piuy						
50				Sen			May working processes	MANAD	Overload OPL			
				3H	ge pressure	: / 0100 kPa	Max. working pressure 2.7 bar	IVIVVI	4 bar			
				3M		/ 0400 kPa	10.7 bar		16 bar			
				3P	010 ba	r / 01000 kPa	26.7 bar		40 bar			
				3S		r / 04000 kPa	100 bar		160 bar			
				3U		oar / 010 MPa	100 bar		160 bar			
				3Z	U400 h	oar / 040 MPa	400 bar		600 bar			
					tive gauge	•	Max. working pressure	MWP	Overload OPL			
				7H 7M		/ -100100 kPa	2.7 bar 10.7 bar		4 bar 16 bar			
				7M 7P		r / -100400 kPa ar / -1001000 kPa	26.7 bar		10 bar 40 bar			
	l I	 	 					, au	1			
				Abso 4H	lute pressi	ıre / 0100 kPa	Max. working pressure 2.7 bar	MWP	Overload OPL 4 bar			
				4M		/ 0400 kPa	10.7 bar		16 bar			
				4P		r / 01000 kPa	26.7 bar		40 bar			
				4S	040 ba	r / 04000 kPa	100 bar		160 bar			
				4U		ar / 010 MPa	100 bar		160 bar			
				4Z	0400 b	ar / 040 MPa	400 bar		600 bar			
60					_	uration and unit		,				
						or range: bar			libration in sensor range			
						or range: kPa/MPa or range: psi			libration in sensor range libration in sensor range			
						ch output 1, see additio	onal specification		libration in sensor range			
					T Swite	ch output $1 + 2$, see ad	ditional specification	Cal	libration in sensor range			
						0 1 /	ee additional specification		libration in sensor range			
						Switch output 1, switch output 2 DESINA, see add. spec. Analog output, switch output DESINA, see add. spec. Calibration in sensor range Calibration in sensor range						
							, .	Cal	libration in sensor range	J		
70						cess connection, n						
					AC AD	Thread ISO 288, G¼ Thread ISO 228, G¼	* **					
					AE	Thread ISO 228, G½.	,					
					AF		A, bore 11.4 mm, 316L					
					AG		A, seal DIN 3852, 316L, flus	h-moun	ited			
					BA	Thread DIN 13, M 12						
					CA DA	Thread 7/16-20 UNF Thread ANSI ¼FNPT	. ,,					
					DD	Thread ANSI 1/2MNP	<i>'</i>					
80	1	 			· · ·	Seal, filling fluid						
30						1 O-ring FKM synt	hetic oil					
						4 O-ring EPDM, sy						
						7 Welded, syntheti	c oil (only for 400 bar sensor)				
90						Additional eq	uipment					
						_	itional equipment					
						B Final inspecti	-					
							connection), inspection certif			٠.		
						D Final inspecti	on report + 3.1 (process conn	ection),	inspect. certificate to EN 102	υ4		

995					Marking:				
					1	Tagging (TAG), see additional spec.			
PTP31						order code			

Ceraphant T PTP35

This overview does not mark options which are mutually exclusive.

Certificate

10		A For non-hazardous areas												
	Α													
20		Ele	ectric	al con	nection									
		1	M 12	2x1 con	nector: IP	tor: IP 65; with sensors for gauge pressure and absolute pressure: IP 66								
		2	M16	x1.5 val	ve plug, IS	e plug, ISO 4400: IP 65								
		3	1/2NP	T valve	plug, ISO	4400: IP 65								
		4	5 m	(16.4 ft)	cable: IP	66								
30			Elec	tronic	s, outpu	t signal								
			A 1	230V	DC, PNP	switch, 3-wire								
			B 1	230V	DC, 2 PN	IP switch, 4-wire								
			C 1	230 \	DC, PNF	switch + 420mA, 4-wi	re							
40			I	Display	7									
			1	With	digital di	splay								
50				Sen	sor									
				Gaug	ge pressure	.	Max. working pressure M	WP	Overload OPL					
				ЗН	01 bar	/ 0100 kPa	2.7 bar		4 bar					
				3M	04 bar	/ 0400 kPa	10.7 bar		16 bar					
				3P	010 ba	ır / 01000 kPa	26.7 bar		40 bar					
				3S	040 ba	r / 04000 kPa	100 bar		160 bar					
	1			Nega	itive gauge	pressure	Max. working pressure M	Overload OPL						
				7H		· / -100100 kPa	2.7 bar	4 bar						
				7M	-14 ba	r / -100400 kPa	10.7 bar		16 bar					
				7P	-110 b	ar / -1001000 kPa	26.7 bar		40 bar					
	ĺ			Abso	lute pressi	ıre	Max. working pressure M	WP	Overload OPL					
				4H		/ 0100 kPa	2.7 bar		4 bar					
				4M	04 bar	/ 0400 kPa	10.7 bar		16 bar					
				4P	010 ba	r / 01000 kPa	26.7 bar		40 bar					
				4S	040 ba	r / 04000 kPa	100 bar		160 bar					
60					Config	uration and unit								
						or range: bar		Cali	ibration in sensor range					
					2 Sens	or range: kPa/MPa		Cali	ibration in sensor range					
					3 Sens	or range: psi	Calibration in sensor range							
					S Swite	ch output 1, see additional	specification	ibration in sensor range						
						ch output $1 + 2$, see additi-	-	ibration in sensor range						
						ch and analog output, see a	•	libration in sensor range						
						. , .	2 DESINA, see add. spec.	ibration in sensor range						
					W Anal	og output, switch output D	DESINA, see add. spec.	Cali	ibration in sensor range					
70					Pro	cess connection, mat	erial							
						Clamp connections								
					DA	, ,	(EHEDG ²⁾ , 3A ¹⁾), 316L, D		,					
					DB		1½") (EHEDG ²⁾ , 3A ¹⁾), 316							
	1				DL	15U 2852 DN40-51 (2")	(EHEDG ²⁾ , 3A ¹⁾), 316L, DI	N326	0/0, DN50					
						Hygienic connections								
					BA	Thread ISO 228 G1A, me flush-mounted for sleeve								
					ВВ		HEDG ²⁾ , 3A ¹⁾), O-ring seat :	seal 3	316I					
					מע	J. C.L.,								
					KL									
					LB Varivent F pipe DN 25-32 (EHEDG ²⁾ , 3A ¹⁾), PN 40, 316L, 3A									
					LL		162 (EHEDG ²⁾ , 3A ¹⁾), PN 4							
					PH		0 (EHEDG ²⁾ , 3A ¹⁾), slotted							
					PL		5 (EHEDG ²⁾ , 3A ¹⁾), slotted	nut, 3	316L					
					HL	APV Inline DN 50 PN 40) (EHEDG ²⁾ , 3A ¹⁾), 316L							

- 1) Suitable fittings and seals must be used for hygienic design in accordance with EHEDG specifications.
- $\hspace{1.5cm} \hbox{Suitable fittings and seals must be used for hygienic design in accordance with 3A specifications. } \\$

80				Seal, filling fluid		
				4	O-ring EPDM, oil conform to FDA	
				8	Without O-ring, oil conform to FDA (only for process connections BA, BB, DA)	

90					Ad	Additional equipment						
					Α	A Without additional equipment						
					В	B Final inspection report						
					С	C 3.1.B process connection, inspection certificate to EN10204						
					D	$\label{eq:final inspection report + 3.1 (process connection), inspect. certificate to EN10204}$						
995						Marking:						
						1 Tagging (TAG), see additional spec.						
			I									
PTP35	1		+	-		order code						

Questionnaire on customerspecific configuration

The Ceraphant T pressure switch can also be ordered with customised settings. For this purpose, please use the questionnaire below. Information on the desired switch point (SP), switch-back point (RSP), lower range value and upper range value always refer to the pressure unit selected. The possible range of adjustment is indicated in the questionnaire in % of the upper range limit (URL). The bold-printed specifications are the factory settings.

Questionnaire for Ce	raphant PTC31, PTP31, PTP35 for customer-specific setup									
Pressure unit	() bar () kPa/MPa () psi									
	1 = Window normally closed () 3 = Window normally open 2 = Hysteresis normally closed () 4 = Hysteresis normally open									
SP:	Range of adjustment: 0,5100 % URL (in increments of 0.1 %, min. 1 mbar *)									
RSP:	Range of adjustment: 099,5 % URL (in increments of 0.1 %, min. 1 mbar *)									
Min. difference $SP - RSP$:	0,5% URL * increments of min. 10 mbar with neg. gauge pressure up to 4 bar									
Function: () 1 = Window normally of	Output 2 (Application 2) (only if available) Function: () 1 = Window normally closed () 3 = Window normally open () 5 = 420 mA (only if available) () 2 = Hysteresis normally closed () 4 = Hysteresis normally open									
SP:	Range of adjustment: 0,5100 % URL (in increments of 0.1 %, min. 1 mbar *)									
RSP:	Range of adjustment: 099,5 % URL (in increments of 0.1 %, min. 1 mbar *) * increments of min. 10 mbar with neg. gauge pressure up to 4 bar									
Analogue output (only if o	utput $2 = 420$ mA output available)									
Range low scale:	Range of adjustment: 0100 % URL									
Range high scale:	Range of adjustment: 0100 % URL Turn down up to 4 : 1									
Failure mode: ()	$1 = \le 3.6 \text{ mA}$ () $2 = \ge 21.0 \text{ mA}$ () $3 = \text{last current value}$									
Connection conform to DESINA (only for 2 outputs): () no () yes Hint: See section "Devices Connection"										
TAG (max. 2 x 18 characters)										
Citalacters)										

P01-PTx3xxxx-16-xx-xx-en-001

Accessories

Welding boss - with sealing taper

■ Welding boss for flush mounting process connection G1 A with metallic sealing taper


(version BA for PTP35) Material: AISI 316L Order number: 52005087

■ Optional with inspection certificate 3.1 Order number: 52010171

■ Welding aid (Dummy) for welding the welding boss without any problems, order number

52005087 or 52010171 Material: brass

Order number: 52005272




Welding boss - with sealing surface

■ Welding boss for flush mounting process connection G1 A with sealing surface (version BB for PTP35)

Material: AISI 316L Order number: 52001051

■ Seal (enclosed): silicone O-ring FDA approved materials according to 21 CFR Part 177.1550/2600

■ Optional with inspection certificate 3.1: Order number: 52011896

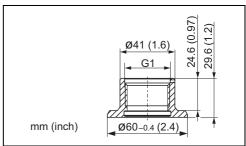

P01-PMP13xxx-00-xx-00-xx-00

Thread adapter

■ PTP31: order numbers for thread adapter versions

Version AC: order no. 52023980 Version AD: order no. 52023981 Version AE: order no. 52023982 Version AF: order no. 52023983 Version BA: order no. 52023984 Version CA: order no. 52023985 Version DA: order no. 52023986 Version DD: order no. 52023987

See chapter "Process connection PTP31 Thread connections" $\rightarrow \stackrel{\triangle}{=} 13$.

Clamp adapter

■ PTP35: Order numbers for clamp adapter versions

Version DB: order no. 52023994 Version DL: order no. 52023995

Optional with inspection certificate 3.1: Version DB: order no. 52024001 Version DL: order no. 52024002

See chapter "Process connection PTP35 Clamp connections" $\rightarrow \stackrel{\triangle}{=} 15$.

Hygiene adapter

■ PTP35: order numbers for hygiene adapter versions

Version KL (EHEDG, 3A): order no. 52026997 Version LB (EHEDG, 3A): order no. 52023996 Version LL (EHEDG, 3A): order no. 52023997 Version PH (EHEDG, 3A): order no. 52023999 Version PL (EHEDG, 3A): order no. 52023998 Version HL (EHEDG, 3A): order no. 52024000

Optional with inspection certificate 3.1: Version KL (EHEDG, 3A): order no. 52026999 Version LB (EHEDG, 3A): order no. 52023996 Version LL (EHEDG, 3A): order no. 52024004 Version PH (EHEDG, 3A): order no. 52024006 Version PL (EHEDG, 3A): order no. 52024005 Version HL (EHEDG, 3A): order no. 52024007

See chapter "Process connection PTP35 Hygiene connections" $\rightarrow \stackrel{\triangle}{=} 14$.

Plug-in jack


M12x1 plug-in jack
 Self-made connection to M12x1 plug
 Materials: Body PA
 Coupling put: Cu Zn, brass, pickeled


Coupling nut: Cu Zn, brass, nickeled Protection: IP 67 (fully locked) Order number: 52006263

 M12x1 plug-in jack, elbowed Self-made connection to M12x1 plug Materials: Body PA

Coupling nut: GD-Zn, brass, nickeled Protection: IP 67 (fully locked)

Order number: 71114212



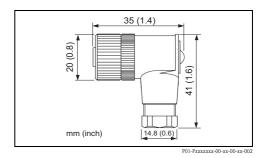

Connecting cable

■ Cable, 4 x 0.34 mm² (AWG 21) with M12 socket, elbowed, screw plug, length 5 m (16 ft), sprayed cable

Materials: Body PUR

Coupling nut: Cu Zn/Ni, brass, nickeled

Cable: PVC

Protection: IP 67 (fully locked) order number: 52010285

■ Cable, 4 x 0.34 mm² (AWG 21) with M12 socket, with LED, elbowed, sprayed cable, length 5 m (16 ft), specially for hygiene applications


(For devices with switch output only) Materials: Body: PVC

Cable: PVC

Coupling nut: 316L

Protection: IP 69K (fully locked) Order number: 52018763 Display: gn: device operational;


ye1: switch status; ye 2: switch status 2

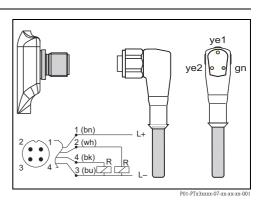

Configuration kit

■ Configuration kit for PC-programmable transmitters. Setup program and interface cable for PCs with USB port. Adapter for transmitters with 4pin post connector. Order code: TXU10-AA

■ ReadWin® 2000 is supplied with the configuration kit or it can be downloaded free of charge directly from the internet at the following address: www.readwin2000.com

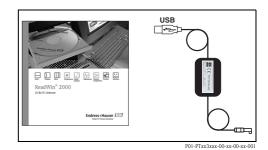

Power supply RNB130

- Primary switched-mode power supply for sensors
- Space saving DIN rail mounting as per IEC 60715.
- Nominal input voltage: 100-240 V AC (wide-range voltage input)
- Output voltage: 24 V DC, max. 30 V in the event of a fault
- Nominal ouput current: 1.5 A
- Connection to monophased a.c. networks or to two phase conductors of three-phase supply networks

Documentation

This supplementary documentation can be found on our product pages on www.endress.com

Field of Activities Pressure measurement, Powerful instruments for process pressure, differential pressure, level and flow: FA00004P/00/EN Technical Information on the Thermophant T temperature switch: **Technical Information** ■ Thermophant T TTR31, TTR35: TI00105R/09/EN ■ Flowphant T DTT31, DTT35: TI00125R/09/EN Operating instructions ■ Ceraphant T PTC31, PTP31, PTP35: KA00225P/00/EN ■ Operating software ReadWin 2000: BA00137R/09/EN

■ Operating software FieldCare: BA00027S/04/C4

Instruments International

Endress+Hauser Instruments International AG Kaegenstrasse 2 4153 Reinach Switzerland

Tel.+41 61 715 81 00 Fax+41 61 715 25 00 www.endress.com info@ii.endress.com



People for Process Automation

